



Abrupt Acceleration

Product: HDX Workman Automatic

September 23, 2016

Affected Units:

Models:

Serial Numbers:

07390

314000101- 315000154

07390H

314000101- 315000101

07390TC

314000101- 314000120

Situation:

Some Workman HDX Automatic vehicles may exhibit a “jerky” or abrupt acceleration condition along with possible turf scuffing when accelerating from a stop.

To address this issue, Toro has released Throttle Cam Kit (132-6715). This kit includes a modified Throttle Bracket assembly and a modified design Primary Clutch Spring. These components, along with re-adjustment of the throttle pedal height detailed in the kit installation instructions improve the clutch engagement during initial acceleration.

To correct this condition, inspect the throttle pedal and cable assemble for any wear and repair or replace as necessary. Install Throttle Cam Kit (132-6715).

Instructions:

Please contact your local Toro Commercial Products Distributor for details on this issue and to obtain this kit and installation assistance.