



# Potential Steering Hardline Contact with Engine Oil Cooler

**Product:** Reelmaster® 5010 Series

**April 20, 2017**

**Affected Units:**

**RM 5010 Yanmar Powered**

**Models:**

03606

03607

03679

**Serial Numbers:**

315000001-316002020

315000001-316002079

315000001-316002009


**Situation:**

A steering hard line could contact the bottom of the engine oil cooler. If this contact continues, over time the steering hard line will wear and may ultimately fail.

**Instructions:**

During maintenance, inspect the area near the engine oil filter/cooler to ensure there is ample clearance between the cooler and the steering hard line. If the hard line is contacting the engine oil cooler, bend the line down, away from the cooler until it clears. Inspect the hard line for any damage that could result in failure.

Please contact your local Toro Commercial Products distributor if you have questions or need assistance to perform this inspection and repair. Reference Commercial Service Bulletin Large Reels 08-42 "Potential Steering Hardline Contact with Engine Oil Cooler" dated April 20, 2017 when making your inquiry.

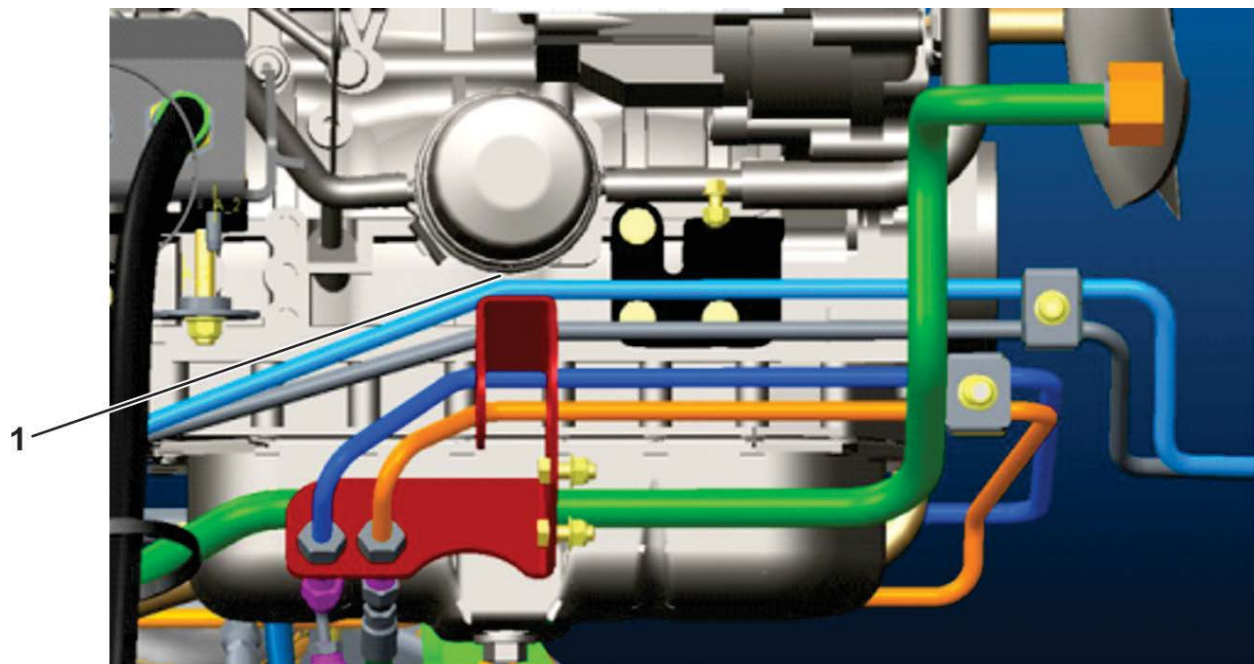

**Figure 1**

1. Area to check for adequate clearance ( $\frac{1}{4}$ " or 6 mm) between hard line and cooler.