



Customer Bulletin

Commercial Products

January 23, 2020

Groomer Drive Direction Knob Falls Off

Universal Groomer Drive (Fairway)

Bulletin Type Information Only


Status Preliminary

Affected Units

Model Number(s)	Serial Number(s)
03763	318000001 to 319999999
03768	318000001 to 319999999

Situation Important Information

The sun's ultraviolet rays can cause the O-ring on the groomer-direction drive knob to deteriorate, which allows the set pin and knob to fall off of the groomer-drive housing.

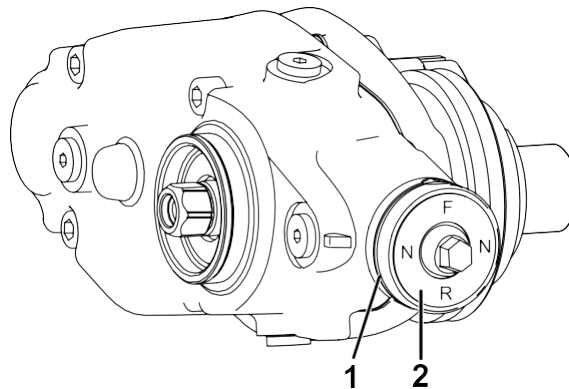

1. O-ring

2. Knob

Corrective Action Fix as Fail

If the O-ring deteriorates, install the Groomer Knob Kit (Part No. 137-0959), which includes a new groomer-drive knob and hex-socket bolt. Refer to your authorized Toro distributor for more information.