



Customer Service Bulletin Commercial Business Group

Greensmaster 3200/3200-D[®]

<u>UNITS AFFECTED:</u>	<u>MODEL NUMBER:</u>	<u>SERIAL NUMBERS:</u>
	04380	60001-70184
	04381	60001-70743

Subject: Traction Pump Shaft Seal leakage.

The traction Piston Pump (93-2586) may exhibit a hydraulic oil leak at the Input Shaft Seal within 500 hours of operation, due to a spiral mark in the shaft surface (marks may not be visible unless magnified). Attempts at repairing the leak with a new seal may result in a repeat leak. A replacement shaft is required to correct the issue.

If your unit exhibits this issue, contact your local Toro distributor for an inspection and repair to correct the problem.

