



# Customer Service Bulletin Commercial Business Group

## Workman® 3000\4000 Series Vehicles

<u>Model/Serial Range:</u>	<u>Model Numbers:</u>	<u>Serial Numbers:</u>
	07216	70101-89999
	07200	70101-89999
	07202	70101-89999
	07205	70101-89999
	07210	70101-89999
	07215	70101-89999

### Subject: Clutch Cable breaking at the Pedal.

If the mounting tab for Clutch Cable is not properly welded to the front frame assembly, the cable will operate at an extreme angle causing the end of the cable to bend throughout its range of motion and eventually break near the clevis.

If a machine in the serial range listed above experiences this issue, it is recommended to replace the Clutch Cable and Clutch Pedal with Improved Clutch Pedal Service Assembly. The improved Clutch Pedal has a Floating Rod End pressed into the lever, and the Clutch Cable has a redesigned clevis. Contact your authorized Toro Distributor for additional details.

- (99-1209) Clutch Pedal Service Assembly (Workman 4WD)
- (99-1206) Clutch Pedal Service Assembly (Workman 2WD)

