



Customer Service Bulletin Commercial Business Group

Multi Pro[®] 1200 and 1250

Date: August 11, 2004

<u>Model/Serial Range:</u>	<u>Model Number:</u>	<u>Serial Numbers:</u>
	41163	240000101-240000602
	41164	240000101-240000450
	41165	240000101-240000425

Subject: A capped vent may cause leaking.

The transaxle used on the Multi Pro 1200 and 1250 sprayers is vented to atmosphere through a tube found at the right rear of the transaxle. During assembly this vent is capped for purposes of cleanliness. The cap installed during assembly may have been left in place which would plug the vent during operation. Leaks may result due to excessive pressures caused by a plugged vent.

During service or maintenance of the affected units check for and remove caps or any other obstruction that may impede venting.

