



Service Part Throttle Cable Is Too Short

Product: Groundsmaster 3280-D

May 31, 2011

Affected Units:	Models:	Serial Numbers:
Groundsmaster 3280-D	30308	250000101-250009999
Groundsmaster 3280-D 4WD	30309	250000101-250009999
Groundsmaster 3280-D	30344	260000101-290009999
Groundsmaster 3280-D 4WD	30345	260000101-290009999

Situation:


Throttle Cable ([108-2033](#)) originally installed in Groundsmaster 3280-D 3320 has become obsolete as of late 2009 production. This part number has been cross-referenced to Throttle Cable ([117-0824](#)). This new cable is approximately 2.3" (58 mm) shorter than 108-2033; it requires different routing as it runs past the right side of the radiator leading back to the engine.

Refer to the attached diagram for installation information and cable routing illustration.

For further information on ordering and the installation of this part, please contact your local Toro Commercial Products Distributor and reference this service bulletin when making your inquiry.

Installation Diagram for Service Part Throttle Cable

Groundsmaster 3280-D

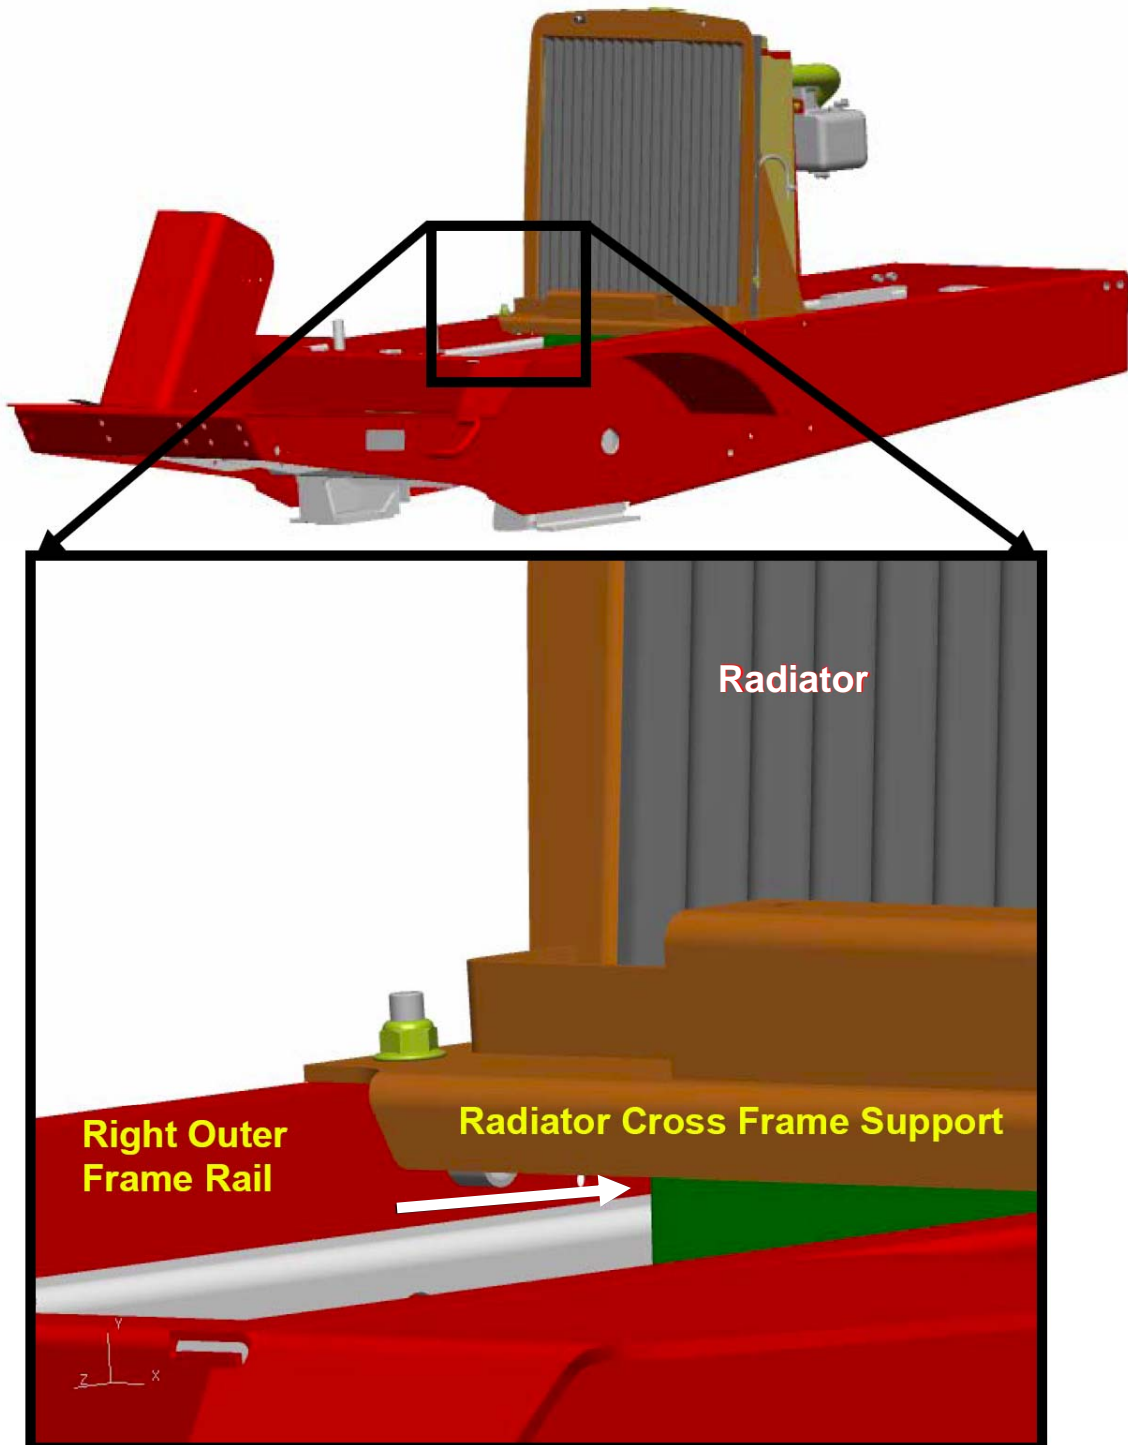

Route Throttle Cable (117-0824) through the opening just below the Radiator support and above the inner right side frame channel (gray colored in this image) back to the engine compartment.