



Replacement Engines Have Different Wiring

Product: Pro Force® Debris Blower

November 12, 2014

Affected Units:

Models:

Serial Numbers:

Pro Force Debris Blower

44538

280000101 - 311000999

Situation: Replacement Kohler engines for early Pro Force Blowers have different wiring than the original equipment. Kohler has changed their ignition coil from a three wire to a single wire design. This change eliminates the need to connect the grey wire in the Toro harness that originally provided twelve volts to the ignition coil via the red Kohler wire.

Instructions: When installing a new engine, use a schematic to ensure the wires from the from the Toro harness are connected to the correct wires on the Kohler harness. Do not connect the grey wire on the Toro harness to any connectors on the Kohler harness. Connect the single white wire from the ignition coil to one of the available white wire terminals on the Kohler harness. Electrical schematics are located in the back of the operator's manual and the Pro Force service manual.

