



Rear Hitch Frame Bar Wears from Implement

Product: Sand Pro/Infield Pro 3040 & 5040

August 20, 2008

Affected Units:

Models:

Serial Numbers:

Sand Pro/Infield Pro 3040

08703

260000101-280000999

Sand Pro/Infield Pro 5040

08705

260000101-280000999


Situation:

The rear Hitch Frame Bar can wear through from contact with the rear QAS attachment Lift Arm during lifting of the implement.

Machines equipped with either the rear Tooth Rake (08751), Rear Broom (08753) or Drag Mat Carrier (08756) should be fitted with a Lift Arm Protection Kit (115-5607). The Kit contains a high density plastic wear pad (for the Lift Arm) and a Frame Bar Sleeve (for the tractor if needed) that will prevent further damage to the Frame Bar.



Wear from contact

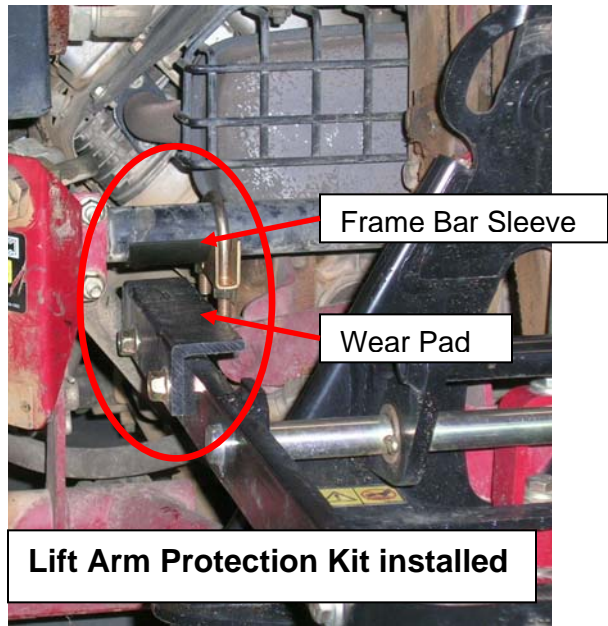

If the rear QAS attachments (Tooth Rake, Rear Broom or Drag Mat Carrier) already have the plastic Wear Pad on the Lift Arm, then no additional action would be required.

Contact you local authorized Toro Commercial Product Distributor for additional information regarding this subject.