



Replacement Parking Brake Pads

Product: Groundsmaster® 7200

April 1, 2011

Affected Units:

Models:

Serial Numbers:

30360, 30360TE,

270000101-310009999

30361, 30361,

30362, 30363

30363TC, 30363TE

30364, 30364TC

30365, 30381

30462, 30464

30464TC, 30465

30467, 30468

Subject: Replacement parking brake pads and adjustable linkage now available

Situation:

Parking brake pads are subject to wear and require periodic replacement. Previously, brake pads for the GM7200 models were only available as part of the caliper assembly. Toro is now offering replacement brake pads separately from the caliper. The new pads incorporate a harder friction material to support increased service life. In addition, the parking brake linkage system has been redesigned for 2011 to provide adjustment to account for pad wear. The adjustable brake linkage can be retrofitted to older traction units.

Instructions:

If parking brake pads require replacement, install the Replacement Brake Pad Service Kit (120-0015). See Figure 1 for base adjustment. The distance of 7.1" (18.03 cm) is the expected distance when new brake pads are installed. This distance will increase as the parking brake pads wear. The important dimensions are the spring length settings. Spring length should be set to 3.5" (8.89 cm) when the parking brake is off. When the parking brake is set correctly and the brake is applied, the spring will be compressed to a 3.0" (7.62 cm) length (0.5" (1.27 cm) of compression).

Attachments:

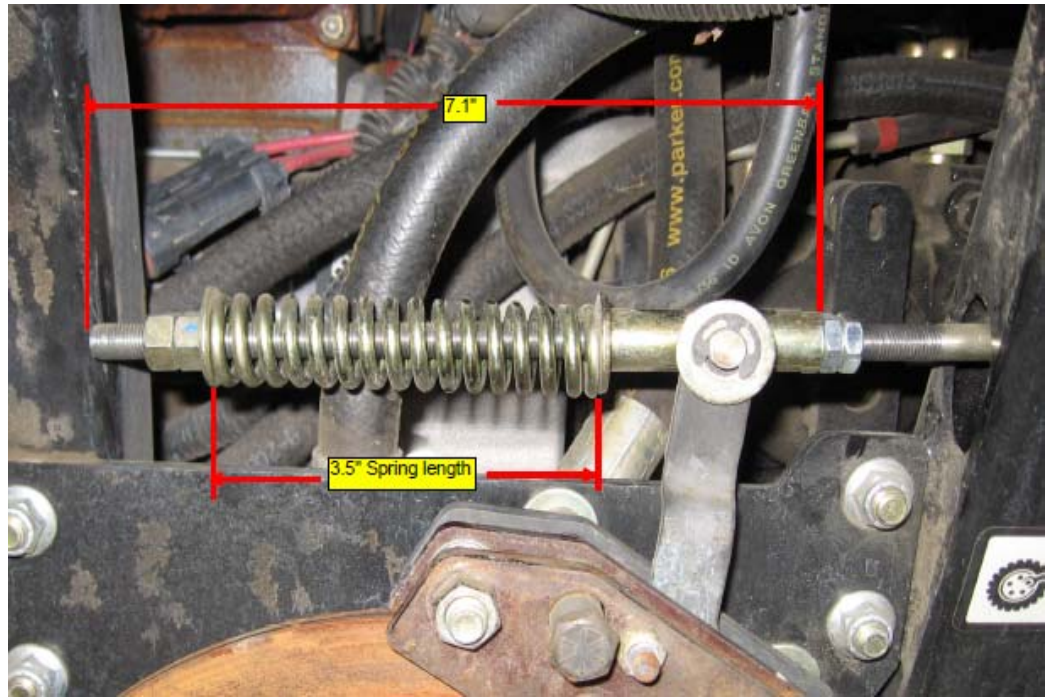


Figure 1

Parts:

Currently available.

Replacement Brake Pad Service Kit (120-0015) Qty 2

Brake Rod (120-0009) Qty 2

Brake Rod (120-0023) Qty 2

Brake Pivot Asm (120-0022) Qty 2

Hex Nut (3219-3) Qty 4

Swivel Assembly (112-1676) Qty 2